

Sheet 1 of 5 Sheets

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(c),
TRACTS 1 THROUGH 16,
P.L. 92-203 (85 STAT. 688, 702, 703)

KIJIK CORPORATION
AT
NONDALTON, ALASKA
AND
THE DEPENDENT RESURVEY OF PORTIONS OF
U.S. SURVEY Nos. 4876, 3420, 7926
AND
AMENDED U.S. SURVEY No. 3876
AND
THE DEPENDENT RESURVEY OF A PORTION OF
T. 2 S. R. 33 W.
SEWARD MERIDIAN, ALASKA

This plat, in 5 sheets contains the entire survey record.

The history of surveys is referenced on sheet number 2.

This survey was executed by Stanley E. Sears, Registered Alaska Land Surveyor No. 2087-S, for Bristol Bay Native Corporation, September 25, 2002 through October 11, 2002, in accordance with the specifications set forth in the Manual of Surveying Instructions, 1973, Special Instructions dated June 4, 2002, approved June 14, 2002, under Contract No. NAC-020160, awarded September 3, 2002 and Notice to Proceed dated September 19, 2002.

Field assistants were:

Tom R. Moore, Surveying Technician
Wassilie (N.M.I.) Wonhola, Sr. Surveying Aide
Marlene M. O'Domin, Surveying Aide

Area Surveyed: 1043.74 Acres

This survey was accomplished using global positioning systems (GPS). The control was obtained using static, fast static, and real time kinematics (RTK) with GPS carrier phase receivers. Monuments were positioned using RTK, and positions were confirmed with a redundant fast static observation.

The mean magnetic declination was computed by U.S.G.S. Geomag program using AK-2000.COF model as of September 15, 2002.

The geographic position of the witness corner to corner No. 1, Tract I, a meander corner, identical with the witness corner to corner No. 1, Tract H, a meander corner, U.S. Survey No. 4876, is:

Latitude: 59° 57' 41.37" North
(NAD 27)
Longitude: 154° 51' 13.13" West

The south and east boundaries and meanders of Township 2 South, Range 32 West, Seward Meridian, were surveyed in 1978.


The retracement of a portion of U.S. Survey No. 4876 and the survey of the Eighth Guide Meridian West through Townships 2 South, between Ranges 32 and 33 West, Seward Meridian, the south and west boundaries, and a portion of the subdivisional lines and meanders of Township 2 South, Range 33 West were surveyed in 1978.

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Anchorage, Alaska

The survey represented by this plat, sheets 1 through 5 having been properly executed and examined, is hereby accepted for having fulfilled the requirements of Section 14(c) of the Alaska Native Claims Settlement Act.

For the Director

Stephen B. Hamisch Sept. 24, 2003
(Acting) Date
Deputy State Director for Cadastral Survey, Alaska

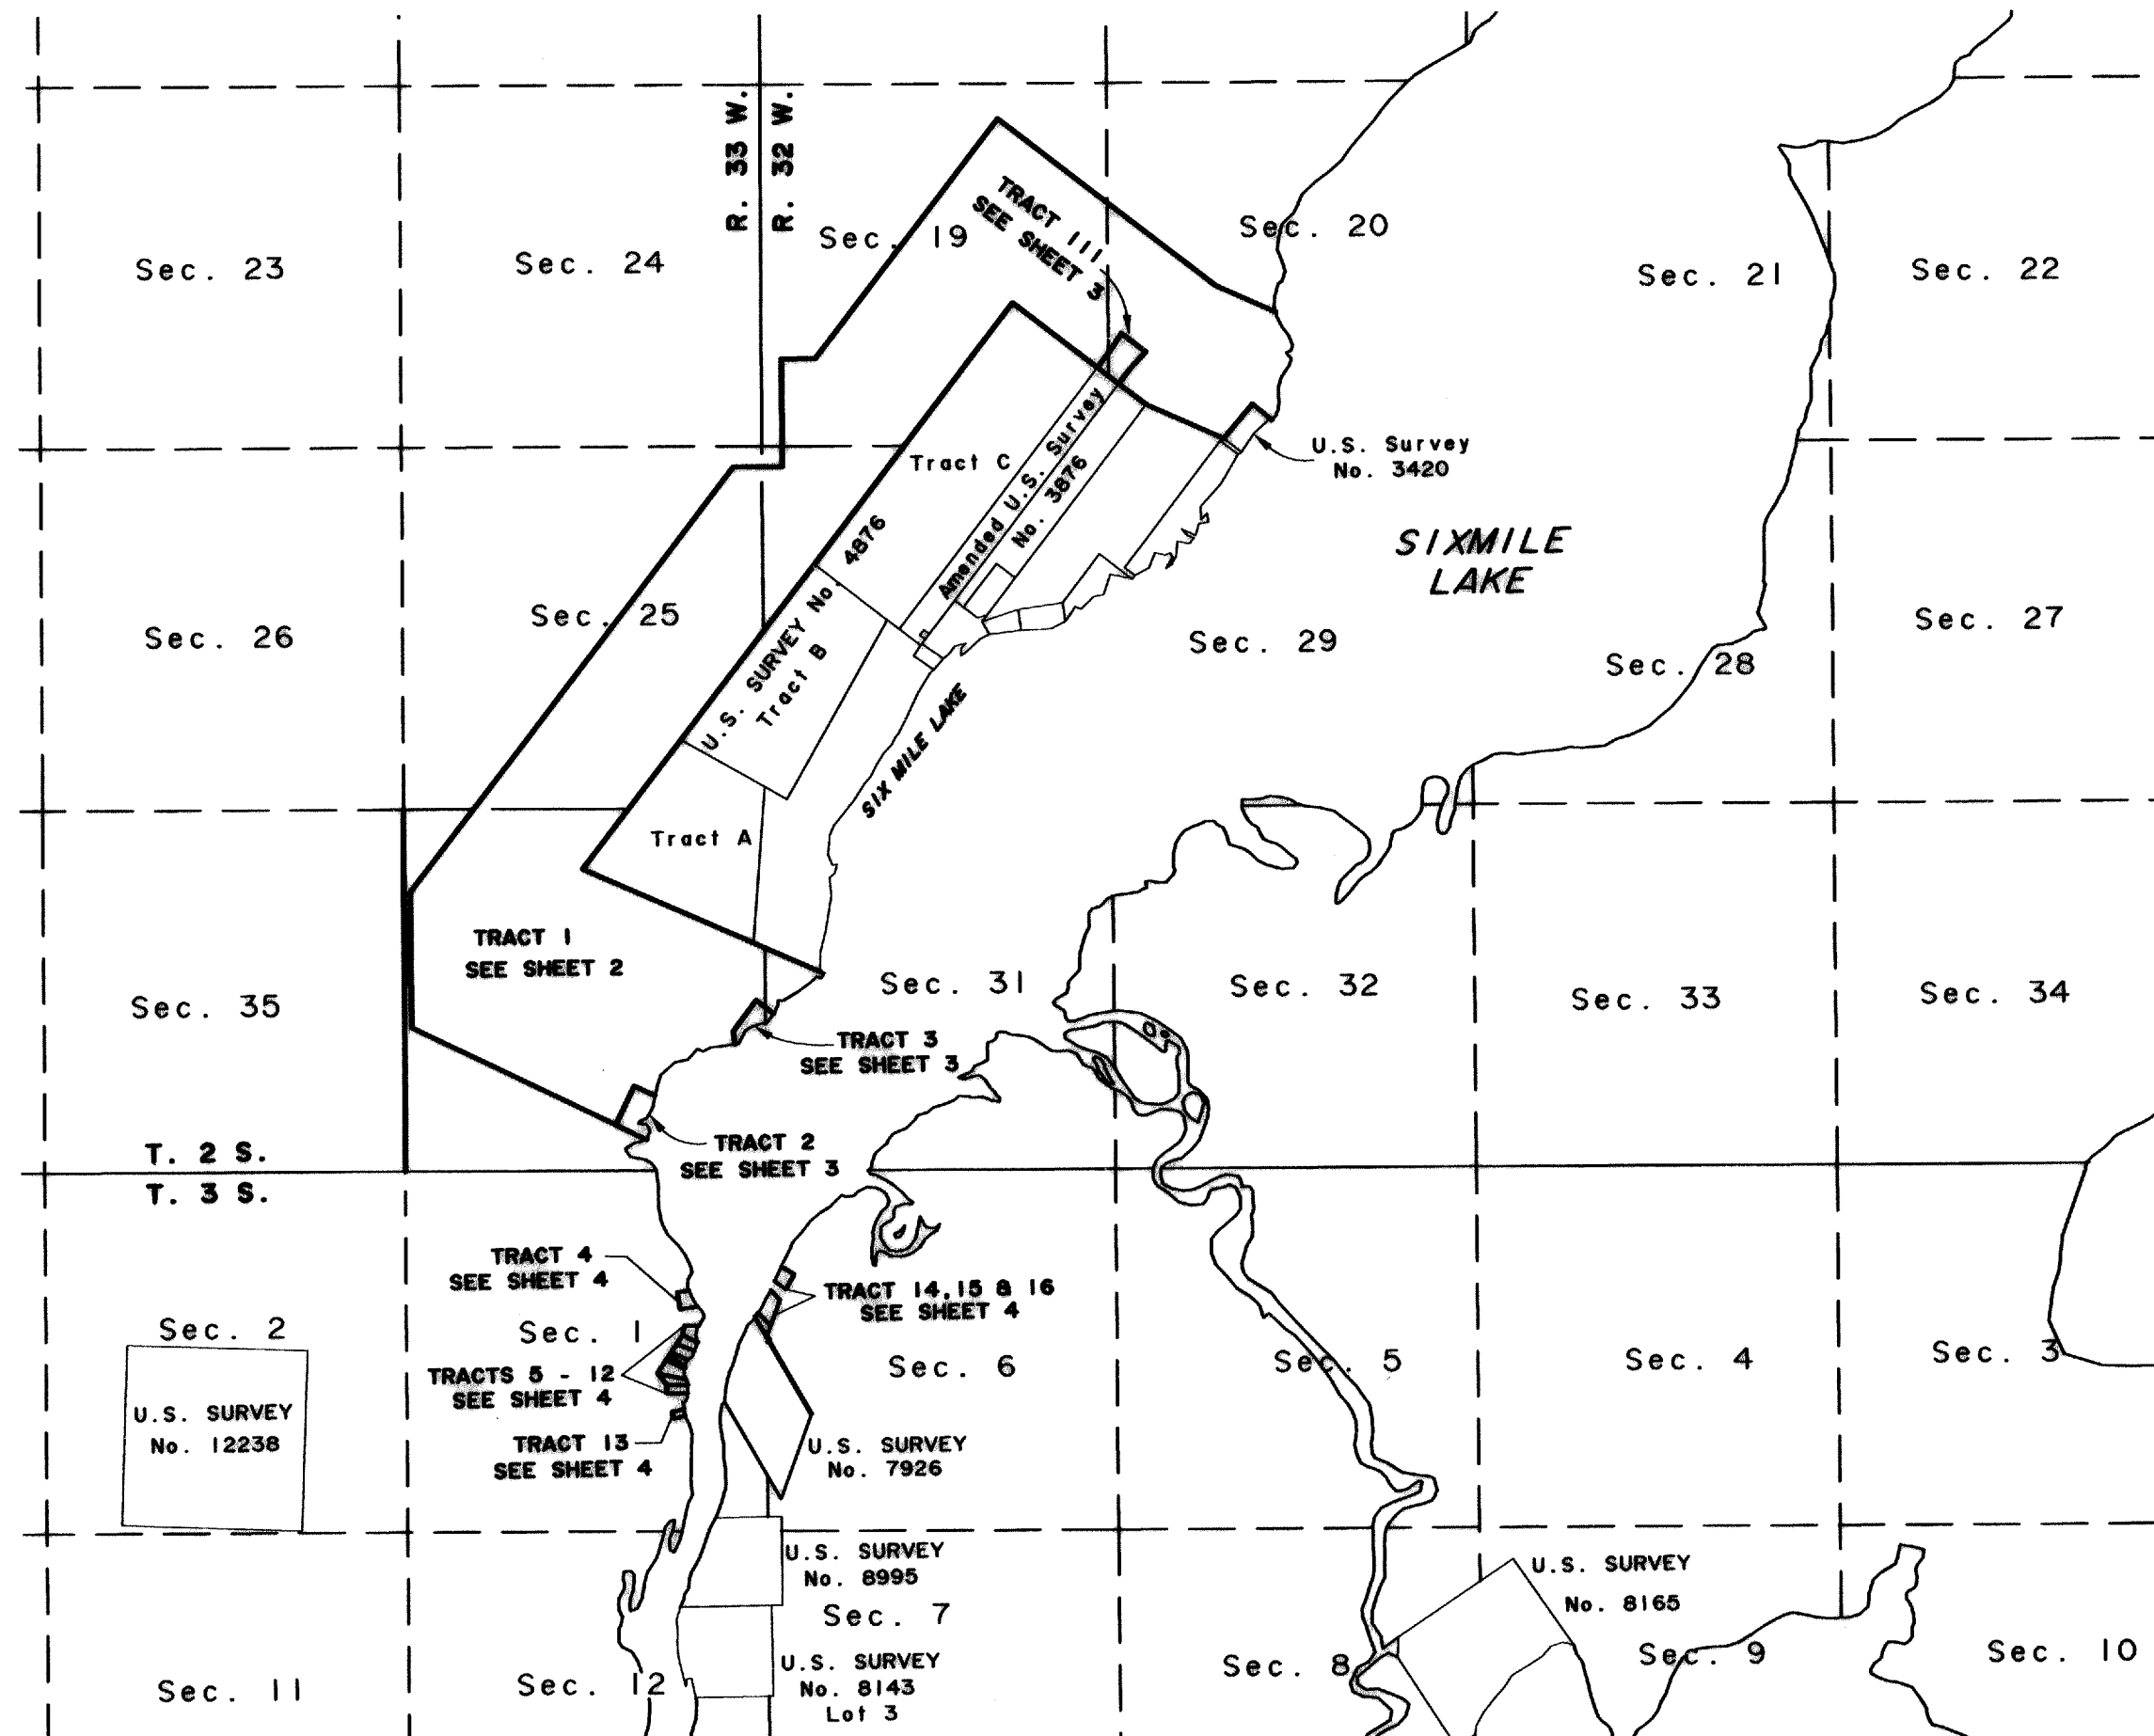

I, STANLEY E. SEARS, Registered Alaska Land Surveyor No. 2087-S, for Bristol Bay Native Corporation, HEREBY CERTIFY upon honor that I have executed the ANCSA 14(c) Survey depicted on this plat, sheets 1-5, in conformity with the Special Instructions approved June 14, 2002, Contract No. NAC-020160, awarded September 3, 2002, the principles of survey described in the Manual of Instructions for the Survey of Public Lands of the United States, 1973, and in the specific manner described on this plat.

September 9, 2003
Date

Stanley E. Sears
Registered Land Surveyor



I hereby certify that Tracts 1 through 16, represented on this plat of survey are on lands transferred to Kijik Corporation, by Interim Conveyance No. 1829, Interim Conveyance No. 300, and Patent No. 50-94-0485 issued by the United States of America, said tracts also fulfill all entitlements under the provisions of ANCSA 14(c) as requested by Kijik Corporation, and the Nondalton ANCSA 14(c) Map of Boundaries accepted December 4, 2001.

09/23/03
Date

Shannon J. Johnson
President, Kijik Corporation

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(c),
TRACTS 1 THROUGH 16,
P.L. 92-203 (85 STAT. 688, 702, 703)

KIJIK CORPORATION
AT
NONDALTON, ALASKA

AND
THE DEPENDENT RESURVEY OF PORTIONS OF
U.S. SURVEY Nos. 4876, 3420, 7926
AND
AMENDED U.S. SURVEY No. 3876
AND
THE DEPENDENT RESURVEY OF A PORTION OF
T. 2 S. R. 33 W.
SEWARD MERIDIAN, ALASKA

The south and east boundaries and a portion of the subdivisional lines and meanders of Township 3 South, Range 32 West, Seward Meridian, were surveyed in 1978.

The Eighth Guide Meridian West through Townships 3 South, Ranges 32 and 33 West, Seward Meridian, the south and west boundaries, a portion of the subdivisional lines and meanders of Township 3 South, Range 33 West were surveyed in 1978.

U.S. Survey No. 4876, located contiguous with Tract I of this survey, was surveyed in 1966.

Amended U.S. Survey No. 3876, located contiguous with Tract I of this survey, was surveyed in 1984.

U.S. Survey No. 3420, located contiguous with Tract I of this survey, was surveyed in 1955.



U.S. Survey No. 7926, located contiguous with Tract 16 of this survey, was surveyed in 1985.

LEGEND


Recovered Bureau of Land Management monument, more fully described herein.

Set an ANCSA 14(c) primary monument, a stainless steel post, 28 ins. long, 2 1/2 ins. dia., 24 to 28 ins. in the ground, with brass cap, mkd. 'ANCSA 14(c), KC', the appropriate corner numbers, tract identifiers, tract lines, and '2002'. Witness cor. and witness cor. to meander cor. have additional mks. MC and/or WC and an arrow pointing to the true point. Deposit a magnet, in a clear plastic case at the base of stainless steel post.

Drive an ANCSA 14(c) secondary monument, an iron rebar, 5/8 in. diam., 30 ins. long, 22 to 28 ins. in the ground, with alum. cap, 2 1/2 ins. diam., mkd. 'KC', the appropriate lines, corner numbers, tract identifiers, and '2002'.

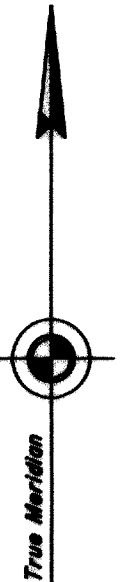

Mean
Magnetic
Declination
18 3/4° E.

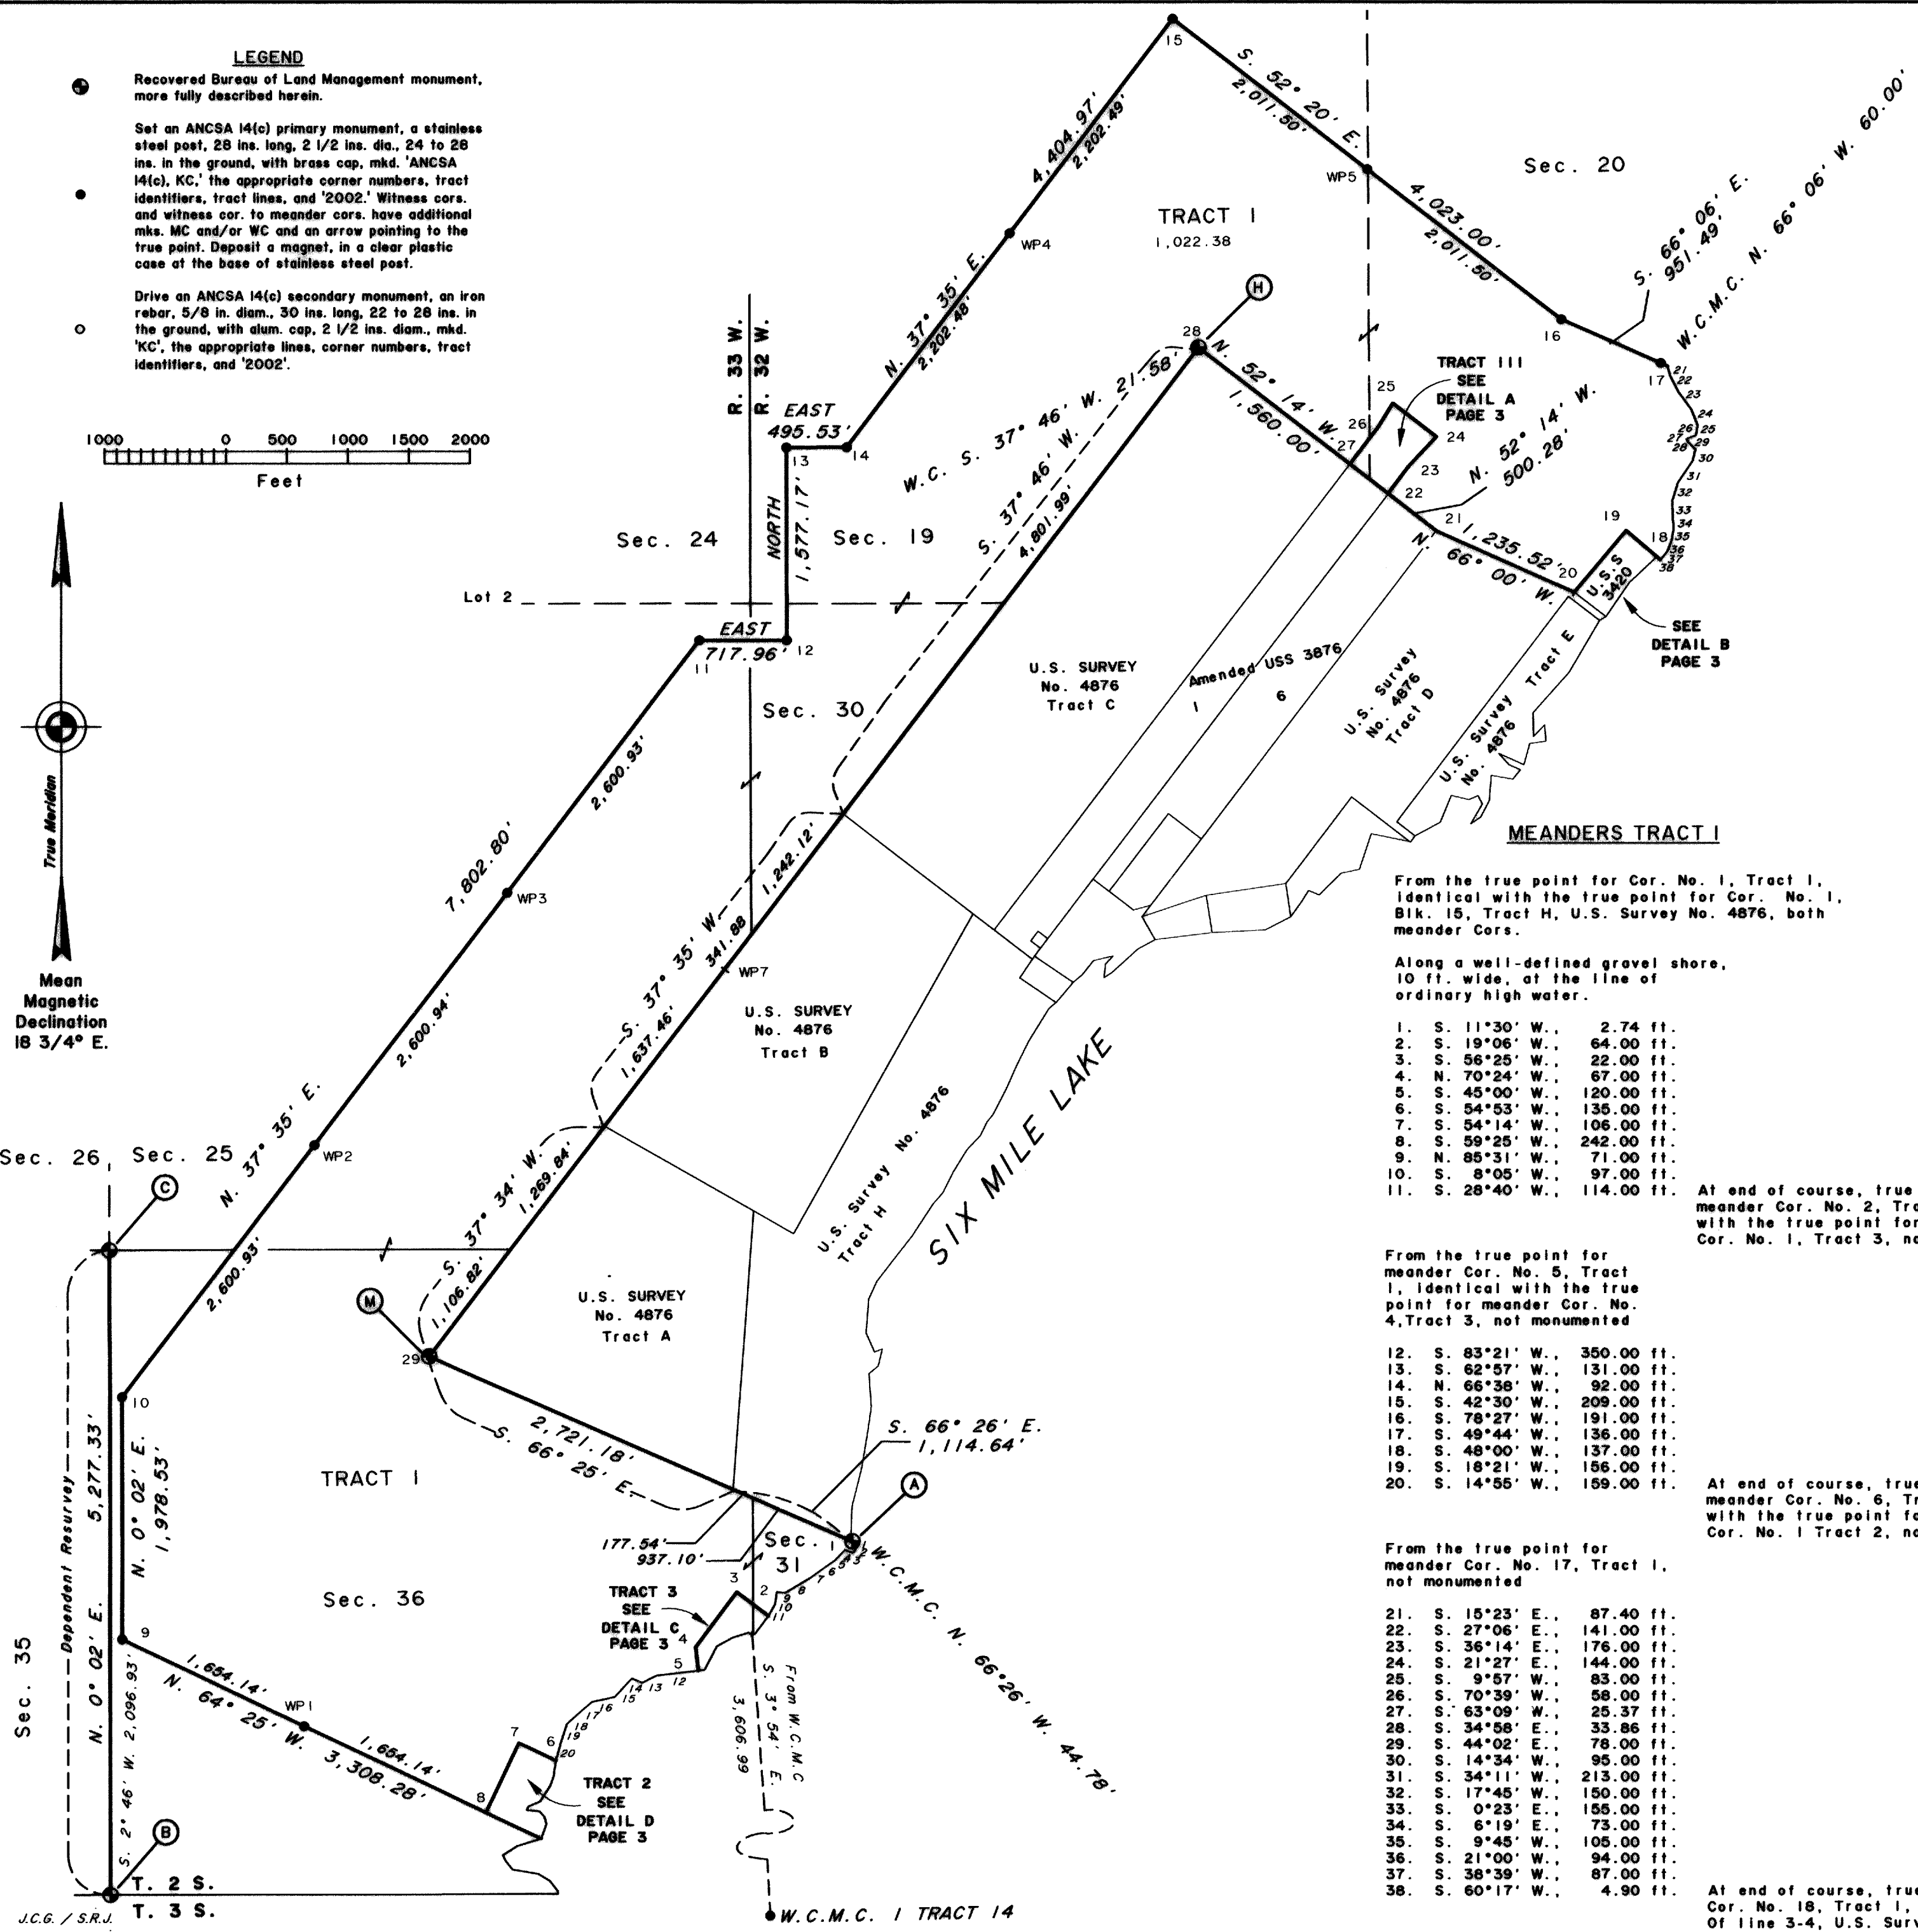

MEANDERS TRACT I

From the true point for Cor. No. 1, Tract I, identical with the true point for Cor. No. 1, Blk. 15, Tract H, U.S. Survey No. 4876, both meander cor.

Along a well-defined gravel shore, 10 ft. wide, at the line of ordinary high water.

1. S. 11°30' W., 2.74 ft.
2. S. 19°06' W., 64.00 ft.
3. S. 56°25' W., 22.00 ft.
4. N. 70°24' W., 67.00 ft.
5. S. 45°00' W., 120.00 ft.
6. S. 54°53' W., 135.00 ft.
7. S. 54°14' W., 106.00 ft.
8. S. 59°25' W., 242.00 ft.
9. N. 85°31' W., 71.00 ft.
10. S. 8°05' W., 97.00 ft.
11. S. 28°40' W., 114.00 ft.

At end of course, true point for meander Cor. No. 2, Tract I, identical with the true point for meander Cor. No. 1, Tract 3, not monumented

From the true point for meander Cor. No. 5, Tract I, identical with the true point for meander Cor. No. 4, Tract 3, not monumented

12. S. 83°21' W., 350.00 ft.
13. S. 62°57' W., 131.00 ft.
14. N. 66°38' W., 92.00 ft.
15. S. 42°30' W., 209.00 ft.
16. S. 78°27' W., 191.00 ft.
17. S. 49°44' W., 136.00 ft.
18. S. 48°00' W., 137.00 ft.
19. S. 18°21' W., 156.00 ft.
20. S. 14°55' W., 159.00 ft.

At end of course, true point for meander Cor. No. 6, Tract I, identical with the true point for meander Cor. No. 1 Tract 2, not monumented

From the true point for meander Cor. No. 17, Tract I, not monumented

21. S. 15°23' E., 87.40 ft.
22. S. 27°06' E., 141.00 ft.
23. S. 36°14' E., 176.00 ft.
24. S. 21°27' E., 144.00 ft.
25. S. 9°57' W., 83.00 ft.
26. S. 70°39' W., 58.00 ft.
27. S. 63°09' W., 25.37 ft.
28. S. 34°58' E., 33.86 ft.
29. S. 44°02' E., 78.00 ft.
30. S. 14°34' W., 95.00 ft.
31. S. 34°11' W., 213.00 ft.
32. S. 17°45' W., 150.00 ft.
33. S. 0°23' E., 155.00 ft.
34. S. 6°19' E., 73.00 ft.
35. S. 9°45' W., 105.00 ft.
36. S. 21°00' W., 94.00 ft.
37. S. 38°39' W., 87.00 ft.
38. S. 60°17' W., 4.90 ft.

At end of course, true point for meander Cor. No. 18, Tract I, on an extension of line 3-4, U.S. Survey No. 3240

REFERENCE SHOULD BE MADE
TO SHEET NO. 1 FOR
ADDITIONAL SURVEY INFORMATION.

Ilamna Recording District
PL 2003-5

S.D.R.

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(c),
TRACTS 1 THROUGH 16,
P.L. 92-203 (85 STAT. 688, 702, 703)


KIJIK CORPORATION
AT
NONDALTON, ALASKA

LEGEND


Recovered Bureau of Land Management monument,
more fully described herein.

Set an ANCSA 14(c) primary monument, a stainless
steel post, 28 ins. long, 2 1/2 ins. dia., 24 to 28
ins. in the ground, with brass cap, mkd. 'ANCSA
14(c), KC,' the appropriate corner numbers, tract
identifiers, tract lines, and '2002.' Witness cors.
and witness cor. to meander cors. have additional
mks. MC and/or WC and an arrow pointing to the
true point. Deposit a magnet, in a clear plastic
case at the base of stainless steel post.


Drive an ANCSA 14(c) secondary monument, an iron
rebar, 5/8 in. diam., 30 ins. long, 22 to 28 ins. in
the ground, with alum. cap, 2 1/2 ins. diam., mkd.
'KC', the appropriate lines, corner numbers, tract
identifiers, and '2002'.

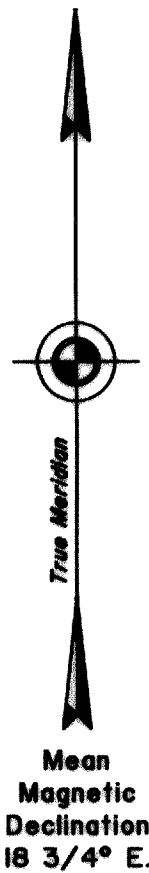


DETAIL A

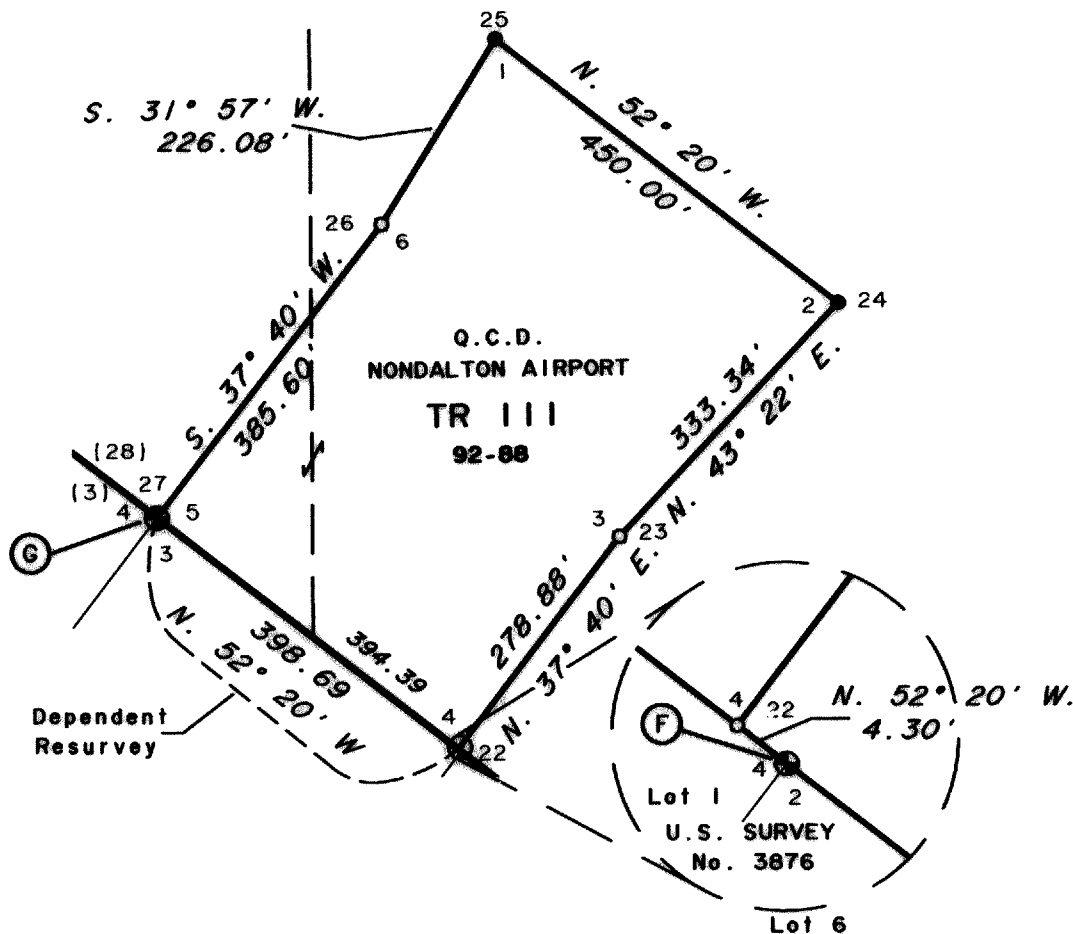

DETAIL B

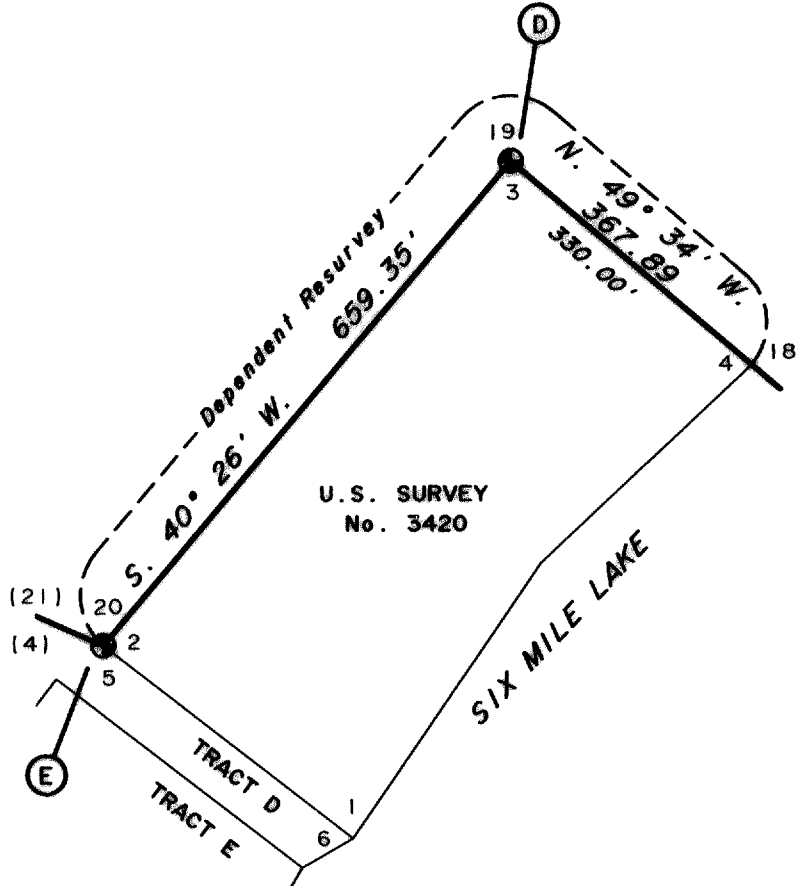

DETAIL C

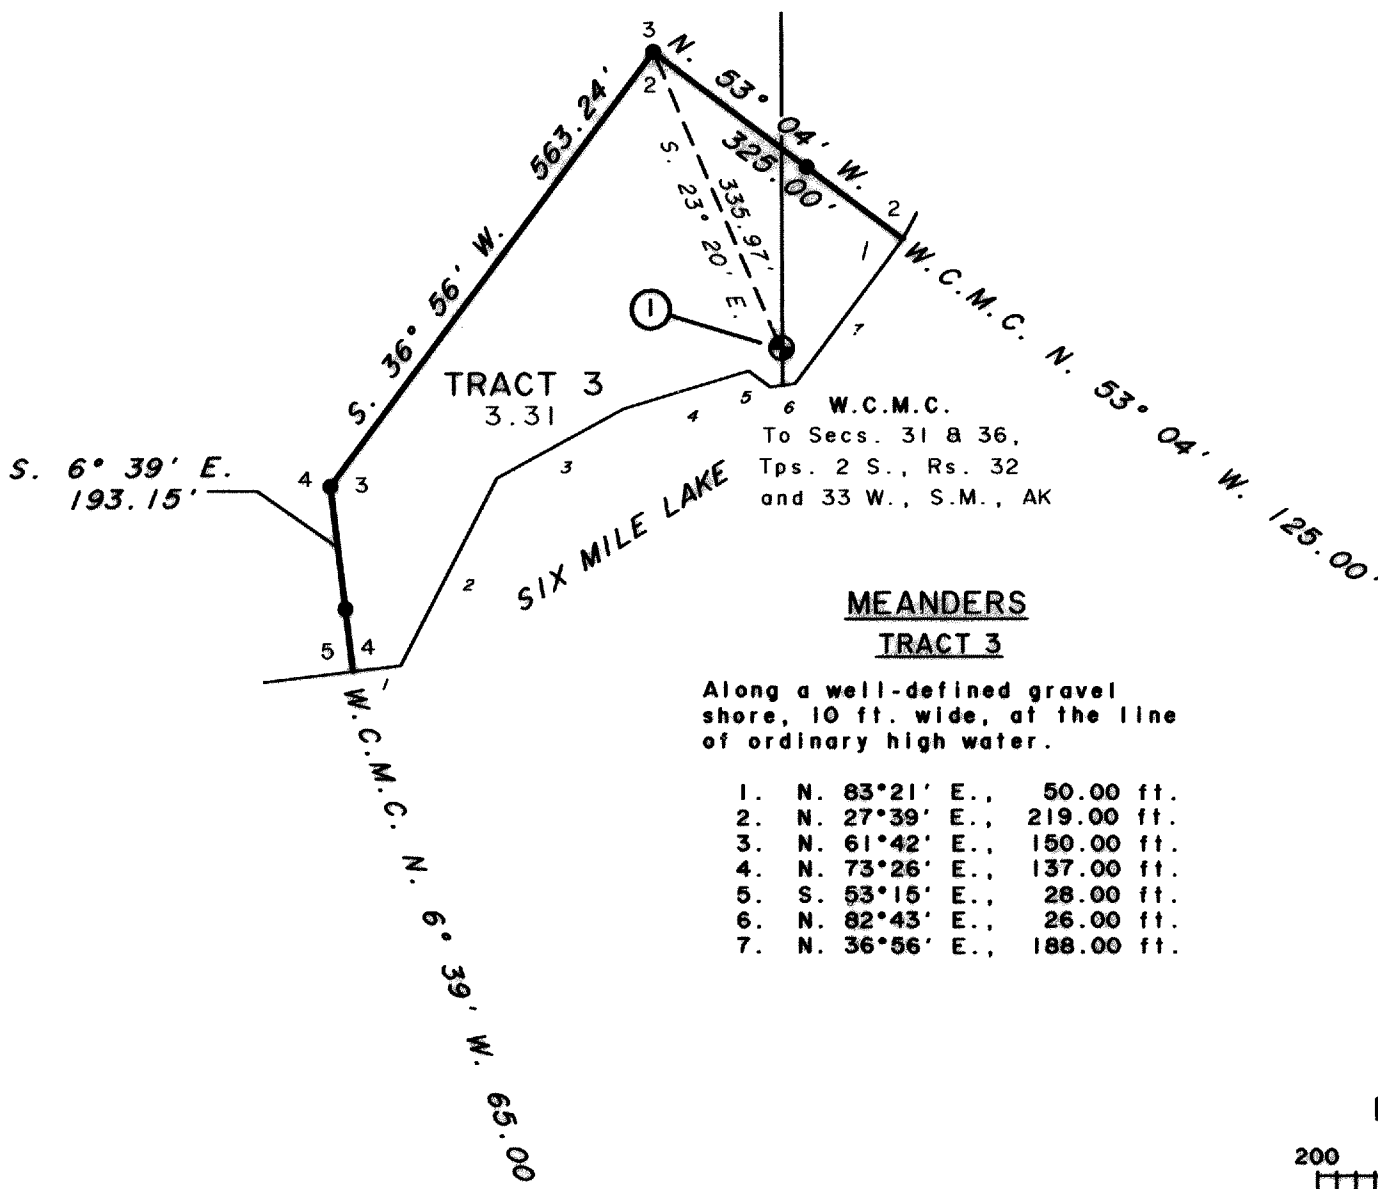

MEANDERS

TRACT 3

Along a well-defined gravel
shore, 10 ft. wide, at the line
of ordinary high water.

1.	N. 83°21' E.	50.00 ft.
2.	N. 27°39' E.	219.00 ft.
3.	N. 61°42' E.	150.00 ft.
4.	N. 73°26' E.	137.00 ft.
5.	S. 53°15' E.	28.00 ft.
6.	N. 82°43' E.	26.00 ft.
7.	N. 36°56' E.	188.00 ft.


MEANDERS

TRACT 2


Along a well-defined gravel
shore, 10 ft. wide, at the line
of ordinary high water.

1.	N. 19°36' E.	127.73 ft.
2.	N. 14°43' W.	64.00 ft.
3.	N. 43°01' W.	59.00 ft.
4.	N. 84°42' W.	104.00 ft.
5.	N. 23°54' E.	33.00 ft.
6.	N. 67°19' E.	105.00 ft.
7.	N. 33°02' E.	154.00 ft.
8.	N. 19°31' E.	79.00 ft.
9.	N. 9°17' E.	133.00 ft.

DETAIL D

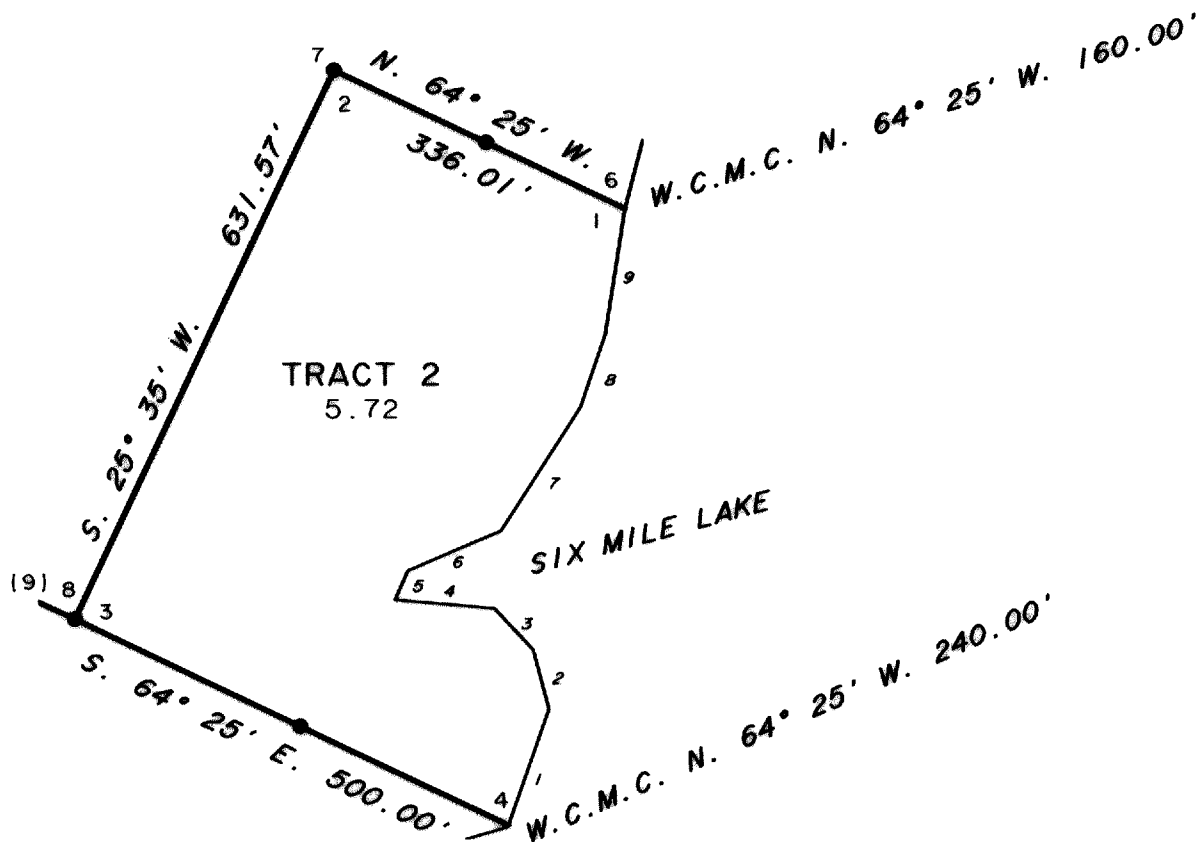

DETAILS A, B, C, & D



REFERENCE SHOULD BE MADE
TO SHEET NOS. 1 AND 2 FOR
ADDITIONAL SURVEY INFORMATION.

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(c),
TRACTS 1 THROUGH 16,
P.L. 92-203 (85 STAT. 688, 702, 703)



KIJIK CORPORATION
AT
NONDALTON, ALASKA

LEGEND

● Recovered Bureau of Land Management monument, more fully described herein.

Set an ANCSA 14(c) primary monument, a stainless steel post, 28 ins. long, 2 1/2 ins. dia., 24 to 28 ins. in the ground, with brass cap, mkd. 'ANCSA 14(c), KC,' the appropriate corner numbers, tract identifiers, tract lines, and '2002.' Witness cor. and witness cor. to meander cor. have additional mks. MC and/or WC and an arrow pointing to the true point. Deposit a magnet, in a clear plastic case at the base of stainless steel post.

○ Drive an ANCSA 14(c) secondary monument, an iron rebar, 5/8 in. diam., 30 ins. long, 22 to 28 ins. in the ground, with alum. cap, 2 1/2 ins. diam., mkd. 'KC,' the appropriate lines, corner numbers, tract identifiers, and '2002.'

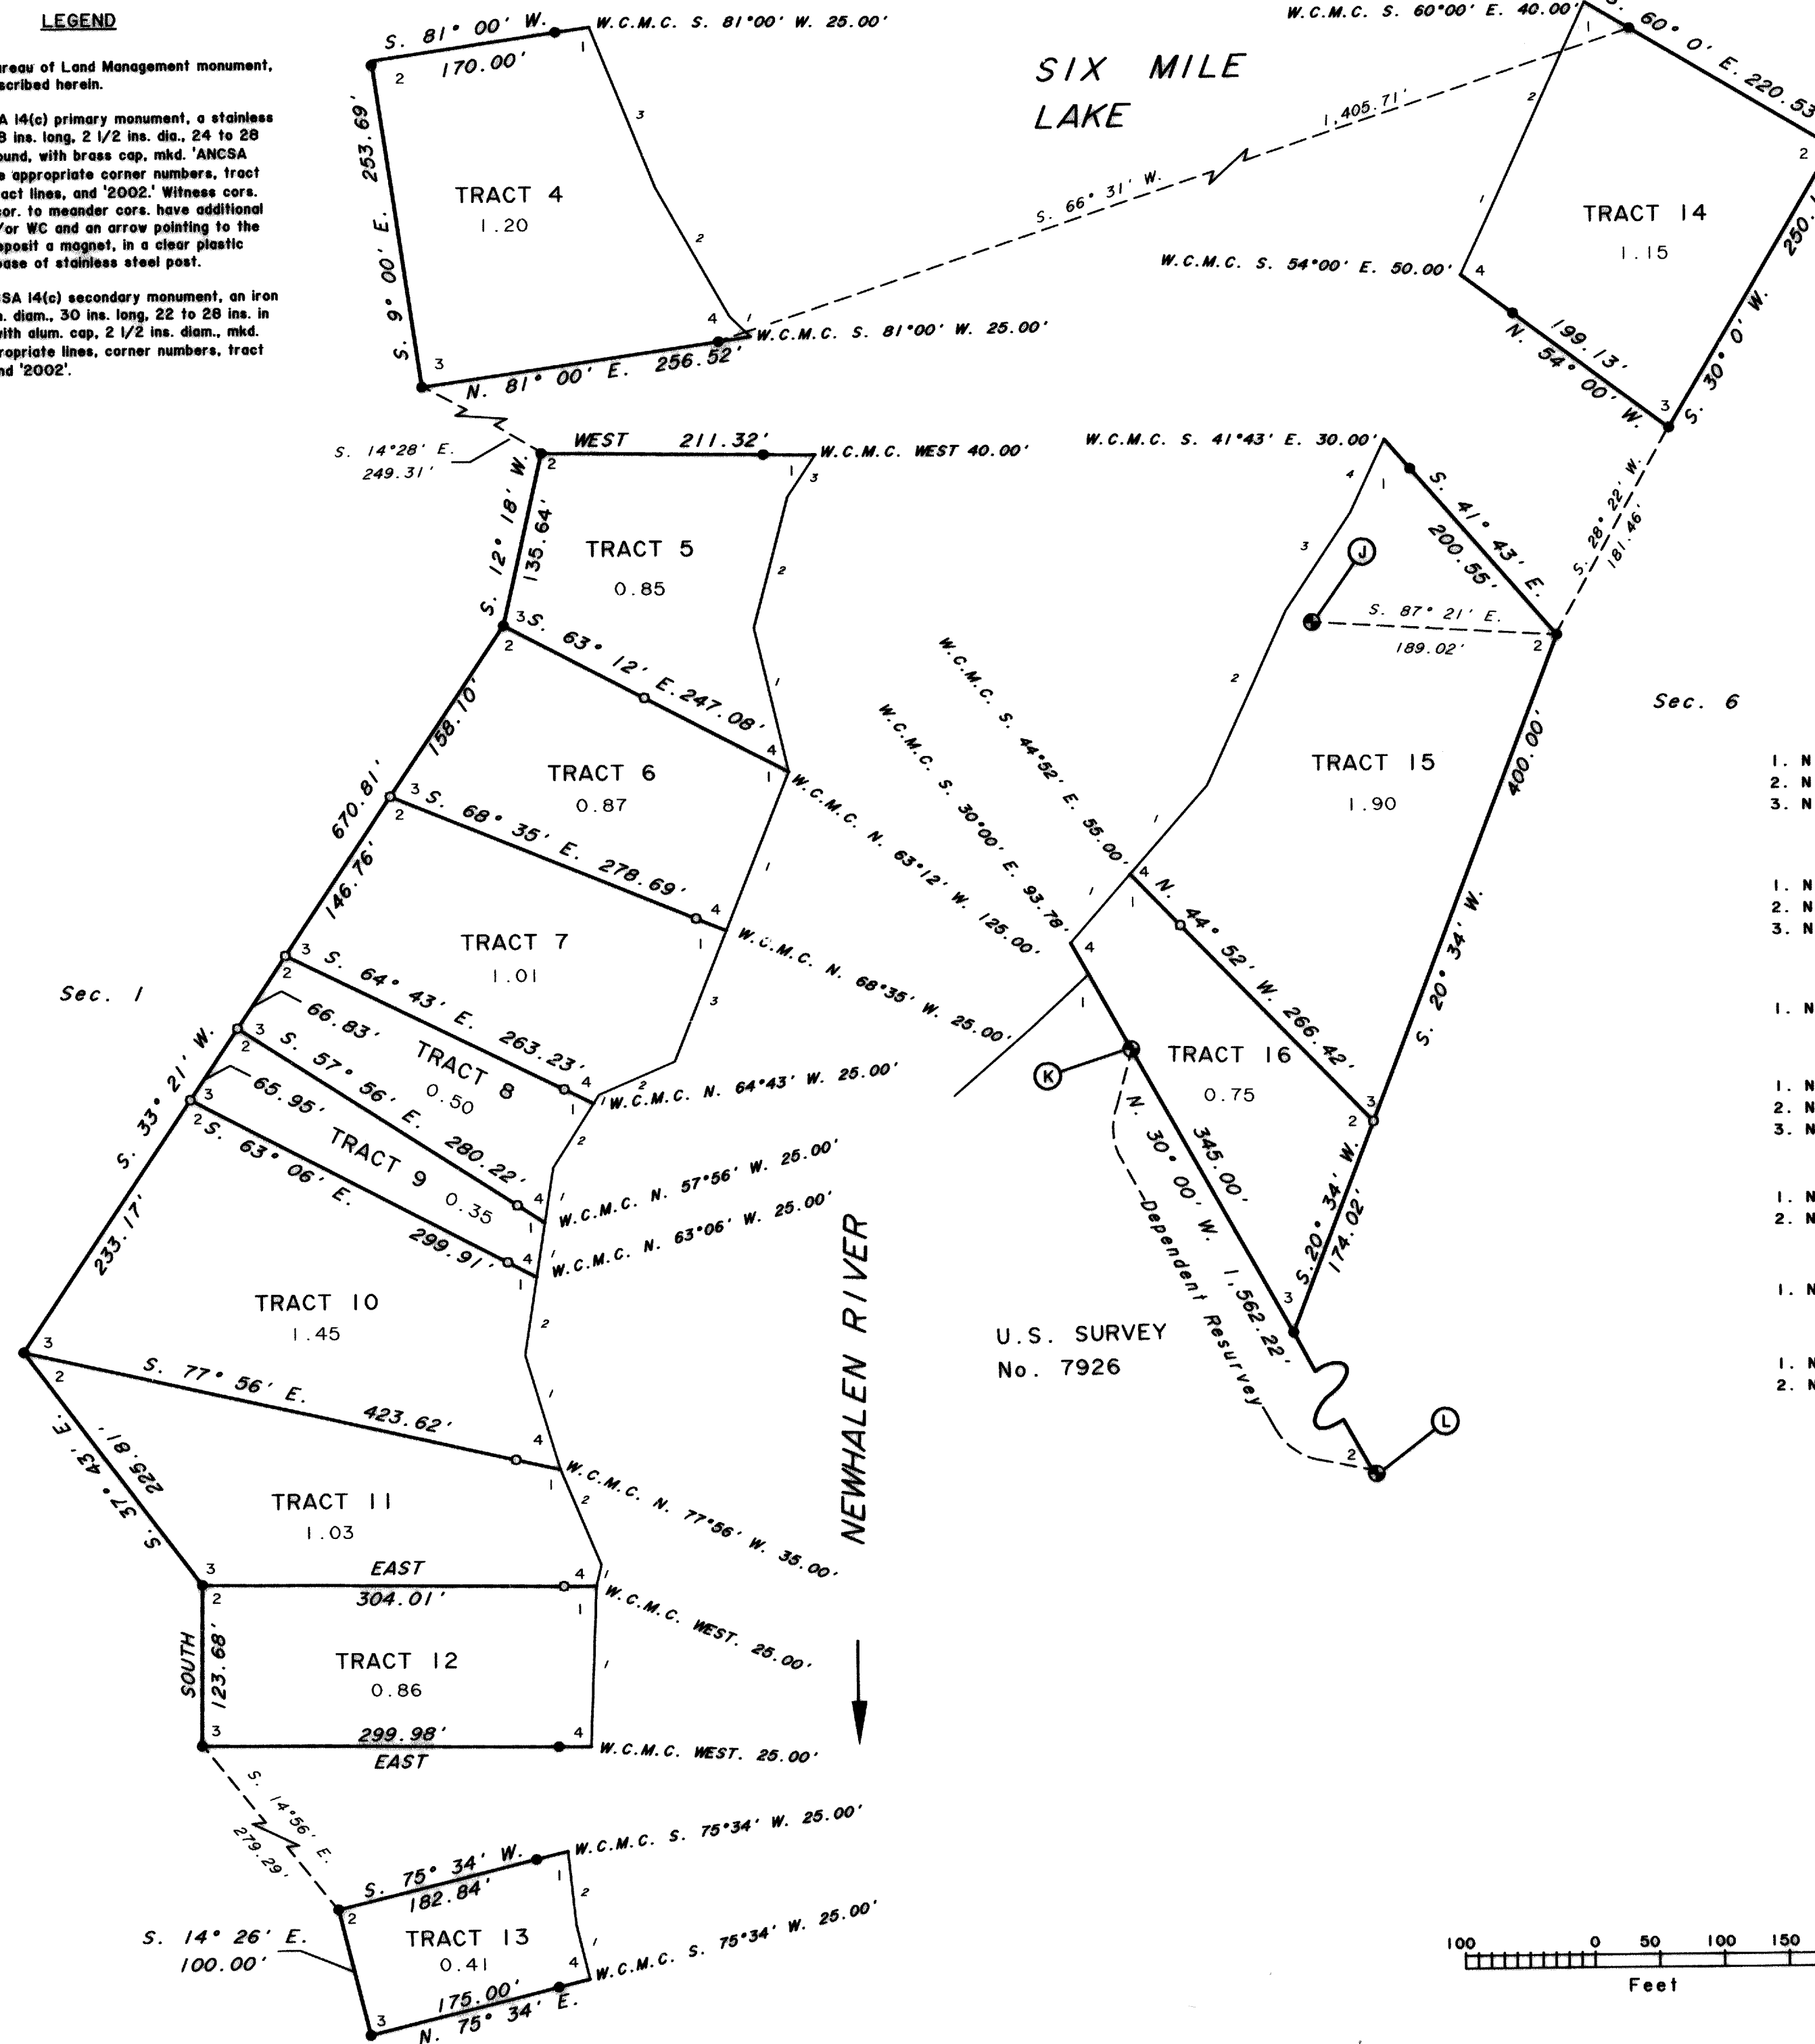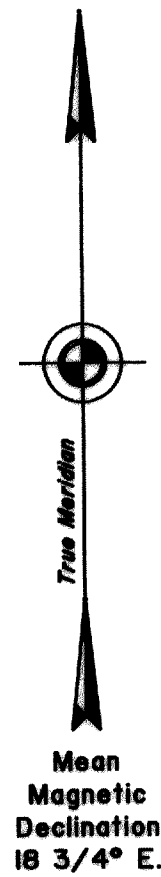

MEANDER LINES FOR TRACTS 4-16
Along a well-defined gravel shore, 10 ft. wide, at the line of ordinary high water

TRACT 4

1. N. 46°24' W. 22.90 ft.
2. N. 30°21' W. 113.00 ft.
3. N. 22°35' W. 134.00 ft.

TRACT 11

1. N. 12°56' E. 17.00 ft.
2. N. 23°24' W. 80.00 ft.

TRACT 5

1. N. 13°54' W. 114.00 ft.
2. N. 14°22' E. 104.00 ft.
3. N. 33°10' E. 38.85 ft.

TRACT 12

1. N. 1°52' E. 123.75 ft.

TRACT 13

1. N. 14°26' W. 43.50 ft.
2. N. 6°32' W. 57.04 ft.

TRACT 6

1. N. 21°25' E. 131.50 ft.

TRACT 14

1. N. 24°45' E. 42.78 ft.
2. N. 24°19' E. 187.61 ft.

TRACT 7

1. N. 31°56' E. 7.50 ft.
2. N. 66°09' E. 64.00 ft.
3. N. 21°25' E. 108.50 ft.

TRACT 15

1. N. 40°47' E. 90.50 ft.
2. N. 24°05' E. 147.00 ft.
3. N. 33°14' E. 90.84 ft.
4. N. 24°45' E. 62.40 ft.

TRACT 8

1. N. 8°29' E. 43.00 ft.
2. N. 31°56' E. 58.50 ft.

TRACT 9

1. N. 6°29' E. 42.48 ft.

TRACT 16

1. N. 40°47' E. 70.00 ft.

TRACT 10


1. N. 17°25' W. 92.00 ft.
2. N. 8°29' E. 60.52 ft.

REFERENCE SHOULD BE MADE
TO SHEETS NOS. 1 AND 2 FOR
ADDITIONAL SURVEY INFORMATION.

ALASKA NATIVE CLAIMS SETTLEMENT ACT
(ANCSA) SECTION 14(c),
TRACTS 1 THROUGH 16,
P.L. 92-203 (85 STAT. 688, 702, 703)


KIJIK CORPORATION
AT
NONDALTON, ALASKA

RECOVERED MONUMENTS

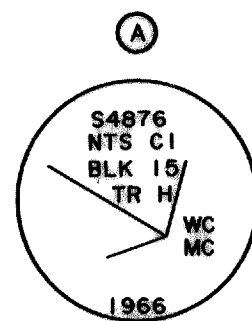

Recovered an iron post, 2 1/2 ins. diam., firmly set 4 ins. below the ground, cap hanging on side of pipe by broken rivet, cap was returned to top of pipe and hammered back on, with a brass cap mkd. as shown.


Record pits not visible.

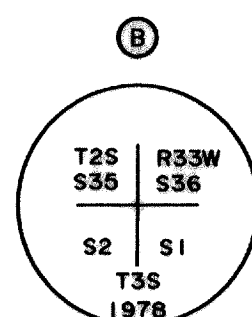

Recovered an alum. post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above the ground, with an alum. cap mkd. as shown, from which the original accessories.

An alum. rod, 3/4 ins. diam., firmly set, projecting 18 ins. above ground bears West, 10 lks. dist., with bleached white alum. triangular marker bolted to the top.

No evidence of original bearing trees found.

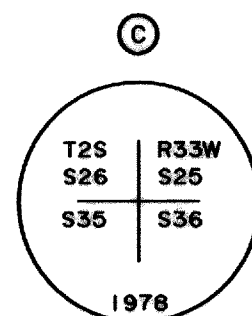


Recovered an alum. rod, 5/8 ins. diam., firmly set, projecting 4 ins. above the ground, with an alum. cap mkd. as shown, from which the original accessories.

A spruce 14 ins. diam., bears S. 42° W., 33 lks. dist. (Record: spruce 9 ins. diam., bears S. 41° E. 53 lks. dist.)


A spruce 16 ins. diam., bears N. 41° W., 56 lks. dist., cut by chainsaw near root crown with unreadable marks. (Record: spruce 10 ins. diam., bears N. 36° E. 71 lks.)

No evidence of other original bearing trees found.

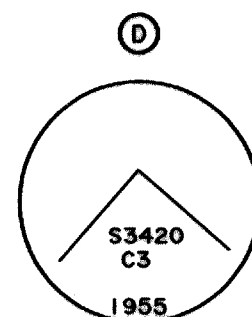


Recovered an iron post, 2 1/2 ins. diam., firmly set, projecting 6 ins. above the ground, with a brass cap mkd. as shown.

Accessories searched for but not located.

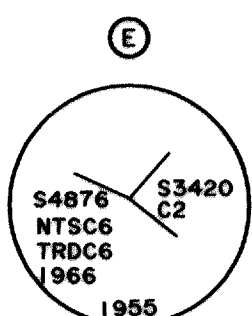


Recovered an iron post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above the ground, with a brass cap mkd. as shown.

Accessories searched for but not located.

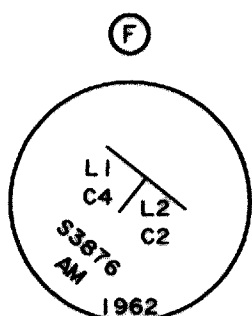


Recovered an iron post, 2 1/2 ins. diam., leaning over slightly, projecting 4 ins. above the ground, straightened at base and firmed, with a brass cap mkd. as shown.

Accessories searched for but not located.

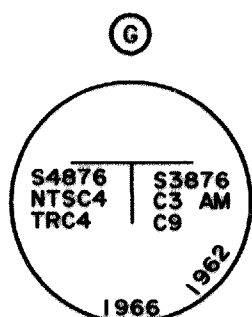

Recovered an iron post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above the ground, with a brass cap mkd. as shown.


Accessories searched for but not located.

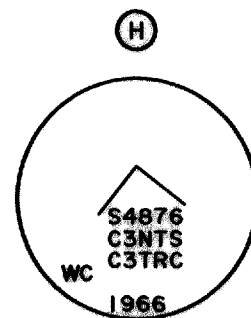

Recovered an iron post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above the ground, with a brass cap mkd. as shown, from which the original accessories;


A double trunked spruce, 18 ins. diam., bears S. 22° E., 24.10 ft. dist. (Record: A double trunked spruce, 6 ins. diam., bears S. 22° 29' W., 23.26 ft. dist.)

No evidence of the other record bearing tree was found.

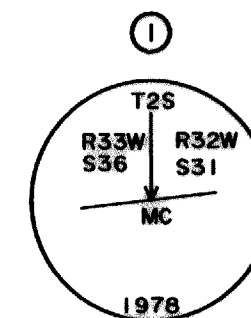

Recovered an alum. post, 2 1/2 ins. diam., loosely set, projecting 6 ins. above the ground, with an alum. cap mkd. as shown.


Accessories searched for but not located.

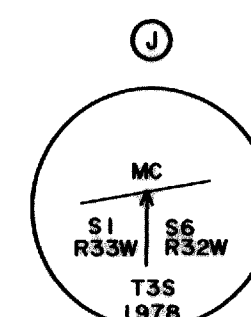

Recovered an iron post, 2 1/2 ins. diam., firmly set, projecting 4 ins. above the ground, with a brass cap mkd. as shown, from which the original accessories;


An alum. rod, 3/4 ins. diam., firmly set, projecting 18 ins. above ground, bears South, 10 lks. dist. with bleached white alum. triangular marker bolted to top.

No evidence of original bearing trees found.

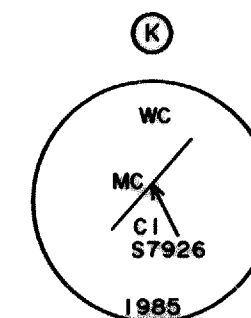


Recovered an alum. post, 2 1/2 ins. diam., firmly set, flush with ground, with an alum. cap mkd. as shown.

Accessories searched for but not located.

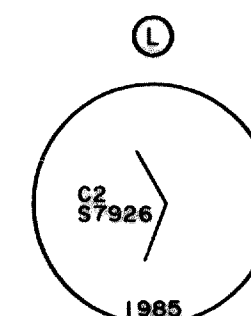

Recovered an alum. post, 2 1/2 ins. diam., firmly set, projecting 2 ins. above the ground, with an alum. cap mkd. as shown.

Accessories searched for but not located.

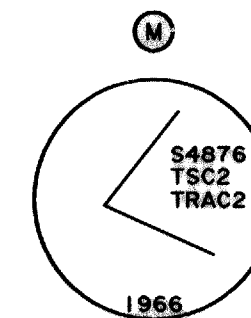

Recovered an iron post, 2 1/2 ins. diam., 28 ins. long, lying on the side under 4 ins. of moss, in a disturbed condition and S. 80° W., 19.8 ft. from the record position with brass cap mkd. as shown.

At the corner point

Reset the original iron post, 24 ins. in the ground, from which the original bearing trees.

A dead spruce, 12 ins. diam., bears N. 53° E., 148 lks. dist.

A dead spruce, 10 ins. diam., bears S. 25° W., 12 lks. dist.


ACCESSORIES FOR SET MONUMENTS

Corner ID Accessories Description Bearing Distance

TRI WCMC5	Silver Magnet Orange Magnet	N. 45° E. N. 45° W.	10.0 ft. 10.0 ft.
TRI WCM6	Silver Magnet Orange Magnet	N. 45° E. N. 45° W.	10.0 ft. 10.0 ft.
TRI C7	Pink Magnet Blue Magnet	S. 45° E. S. 45° W.	10.0 ft. 10.0 ft.
TRI C8	Silver Magnet Orange Magnet	N. 45° E. N. 45° W.	10.0 ft. 10.0 ft.
TRI WP1	Spruce 7" Diam. Spruce 4" Diam.	N. 70° E. S. 35° E.	26.9 ft. 47.5 ft.
TRI C9	Spruce 4" Diam. Spruce 7" Diam.	S. 82° W. N. 42° W.	40.6 ft. 59.7 ft.
TRI C10	Spruce 8" Diam. Spruce 8" Diam.	S. 62° W. N. 58° W.	14.0 ft. 17.5 ft.
TRI WP2	Spruce 5" Diam. Spruce 8" Diam.	N. 48° E. S. 24° E.	18.1 ft. 18.3 ft.
TRI WP3	Spruce 13" Diam. Spruce 4" Diam.	S. 62° E. S. 38° W.	43.3 ft. 19.2 ft.
TRI C11	Spruce 4" Diam. Spruce 11" Diam.	N. 4° W. S. 72° W.	15.5 ft. 21.6 ft.
TRI C12	Silver Magnet Orange Magnet	N. 45° E. N. 45° W.	10.0 ft. 10.0 ft.
TRI C13	Spruce 10.5" Diam. Spruce 7" Diam.	S. 35° E. N. 87° E.	39.4 ft. 47.6 ft.
TRI C14	Spruce 4" Diam. Spruce 5" Diam.	N. 78° E. S. 29° E.	21.6 ft. 45.0 ft.
TRI WP4	Spruce 10" Diam. Spruce 8" Diam.	S. 55° W. N. 77° W.	18.3 ft. 21.2 ft.
TRI C15	Spruce 11" Diam. Spruce 10" Diam.	N. 42° E. S. 40° E.	49.0 ft. 29.3 ft.
TRI WP5	Silver Magnet Pink Magnet	N. 45° E. S. 45° E.	10.0 ft. 10.0 ft.
TRI C16	Spruce 7" Diam. Spruce 7" Diam.	N. 83° E. S. 31° E.	52.4 ft. 33.5 ft.
TRI WCMC17	Spruce 4.5" Diam. Orange Magnet	S. 68° W. N. 45° W.	9.4 ft. 10.0 ft.
TRI C24	Silver Magnet Orange Magnet	N. 45° E. N. 45° W.	10.0 ft. 10.0 ft.
TRI C25	Spruce 6" Diam. Pink Magnet	N. 52° E. S. 45° E.	72.3 ft. 10.0 ft.
TR2 WCMC4	Blue Magnet Orange Magnet	S. 45° W. N. 45° W.	10.0 ft. 10.0 ft.

2003.5
FLIAMA REC DIST
Date 09-24-2003
Time 1:55 PM
Requested By
Address

TYPICAL CAP MARKINGS

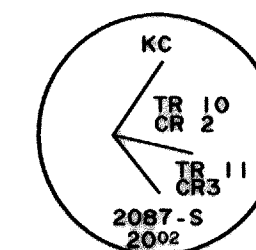

REFERENCE SHOULD BE MADE
TO SHEET NOS. 1 AND 2 FOR
ADDITIONAL SURVEY INFORMATION.